


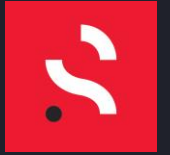

RMS 
RELIABILITY MAINTENANCE SOLUTIONS



Case Study – Wireless - Kappa X Unbalance Problem

Power Plant - Food Sector



Background




- Critical Gas Fan part of a power plant for a food production factory
- 1485 RPM Direct Drive Fan – 250kW
- Kappa X wireless sensors installed on the fan to monitor condition- 1 min short term trends, with power bands, spec, waveform
- HMI Software setup in control room for site Ops to monitor. Alarms setup based on current fan levels. System will email / text - key personnel when broken.

Short term 1 min trends – Motor NDE – Velocity mm/sec RMS




Analysis

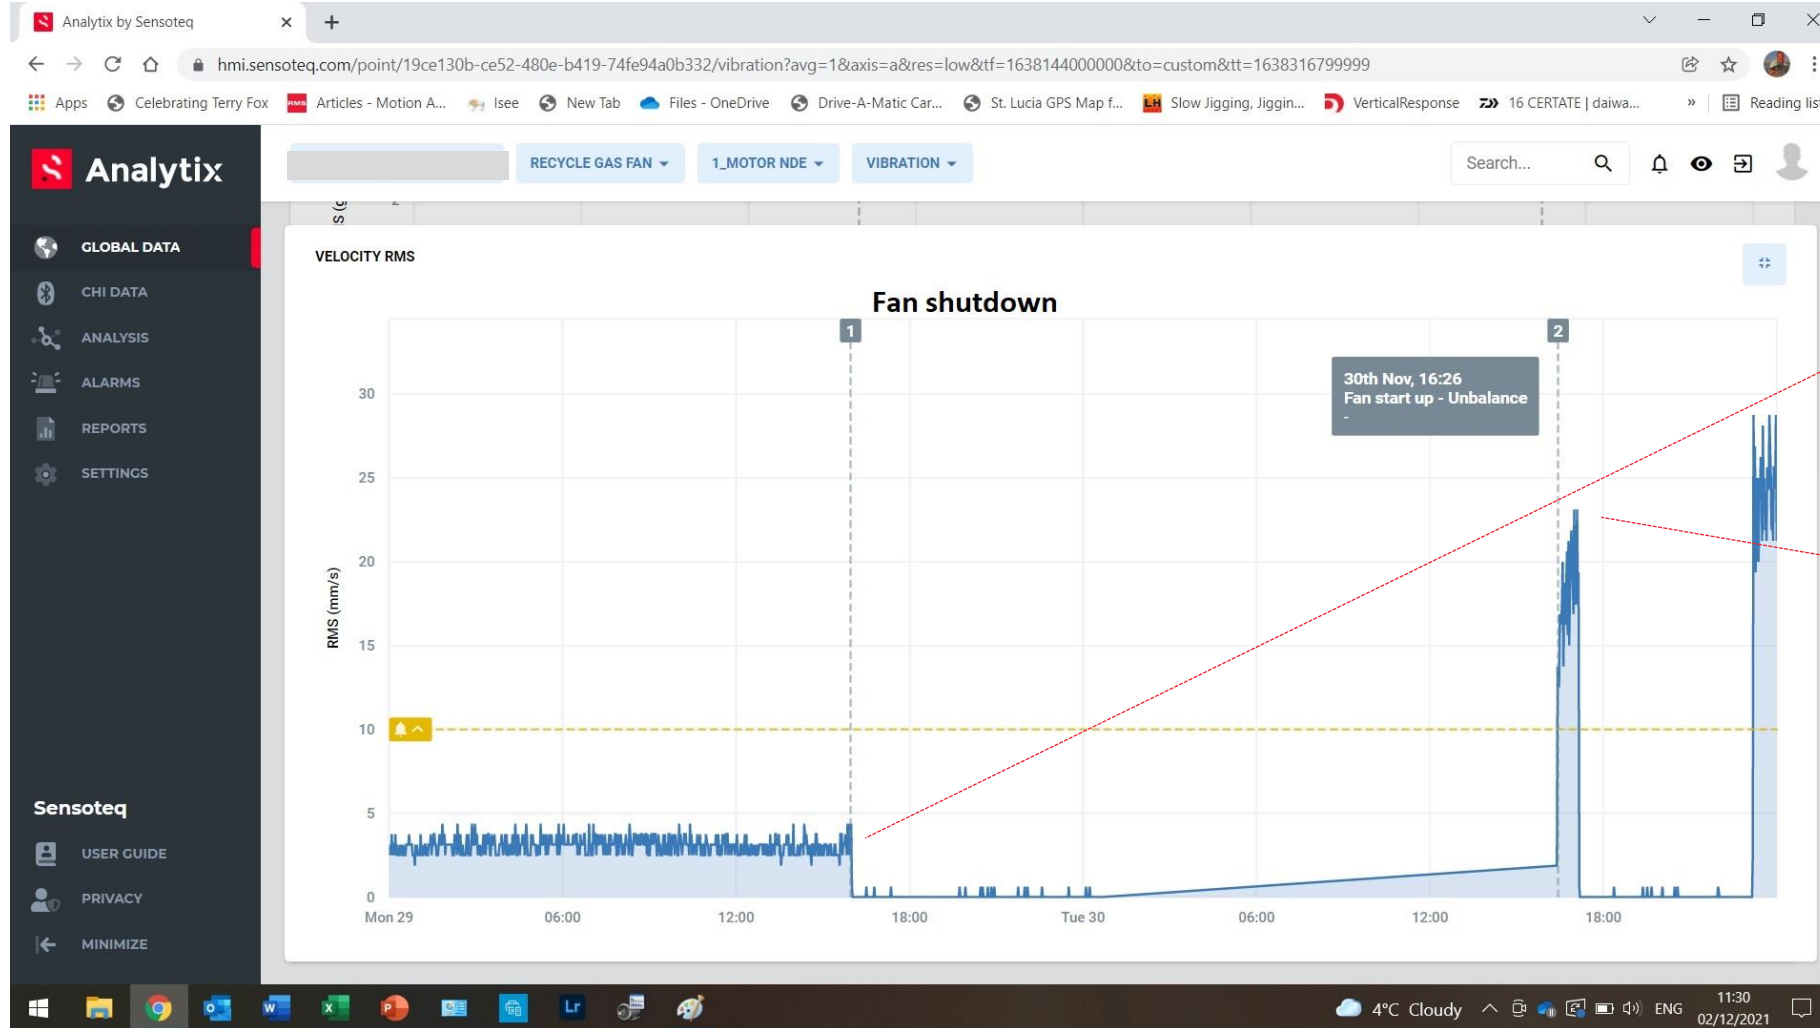

- Fan shut down as one dryer was brought offline.
- Upon restart, sharp increase in velocity levels up to 20mm/sec RMS, previous levels were 4 mm/sec RMS.
- Alarms broken PDM team alerted

Spectral / Waveform Data – Motor NDE

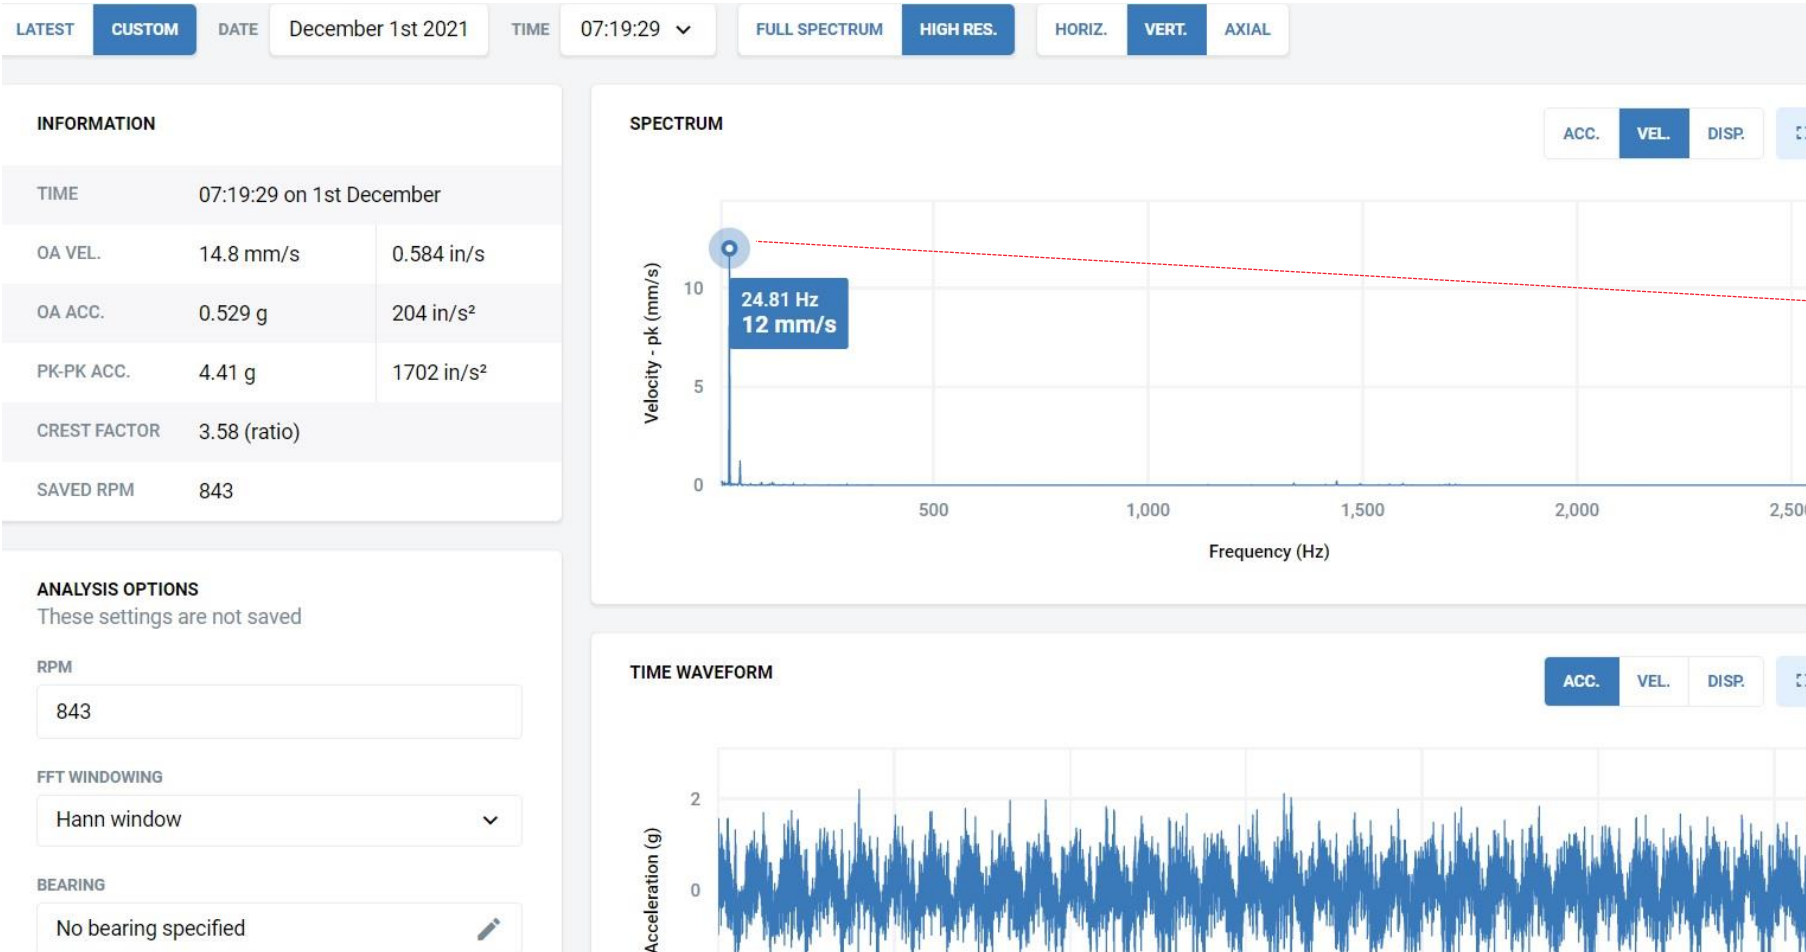

Analysis

- Spectral data showed high 1XRPM, suspected unbalance
- Low G's on waveform
- Decision was made to inspect fan impellor for signs of damage or dirt build up.

Fan inspection – Before & After Clean




Analysis

- Fan inspected, found to have heavy dirt deposits on the impellor and casing
- Fan thoroughly cleaned
- **Suspected root cause of unbalance was significant piece of dirt fell off during start-up of the fan.**

Before and After Fan Clean - Trend Data



VELOCITY RMS

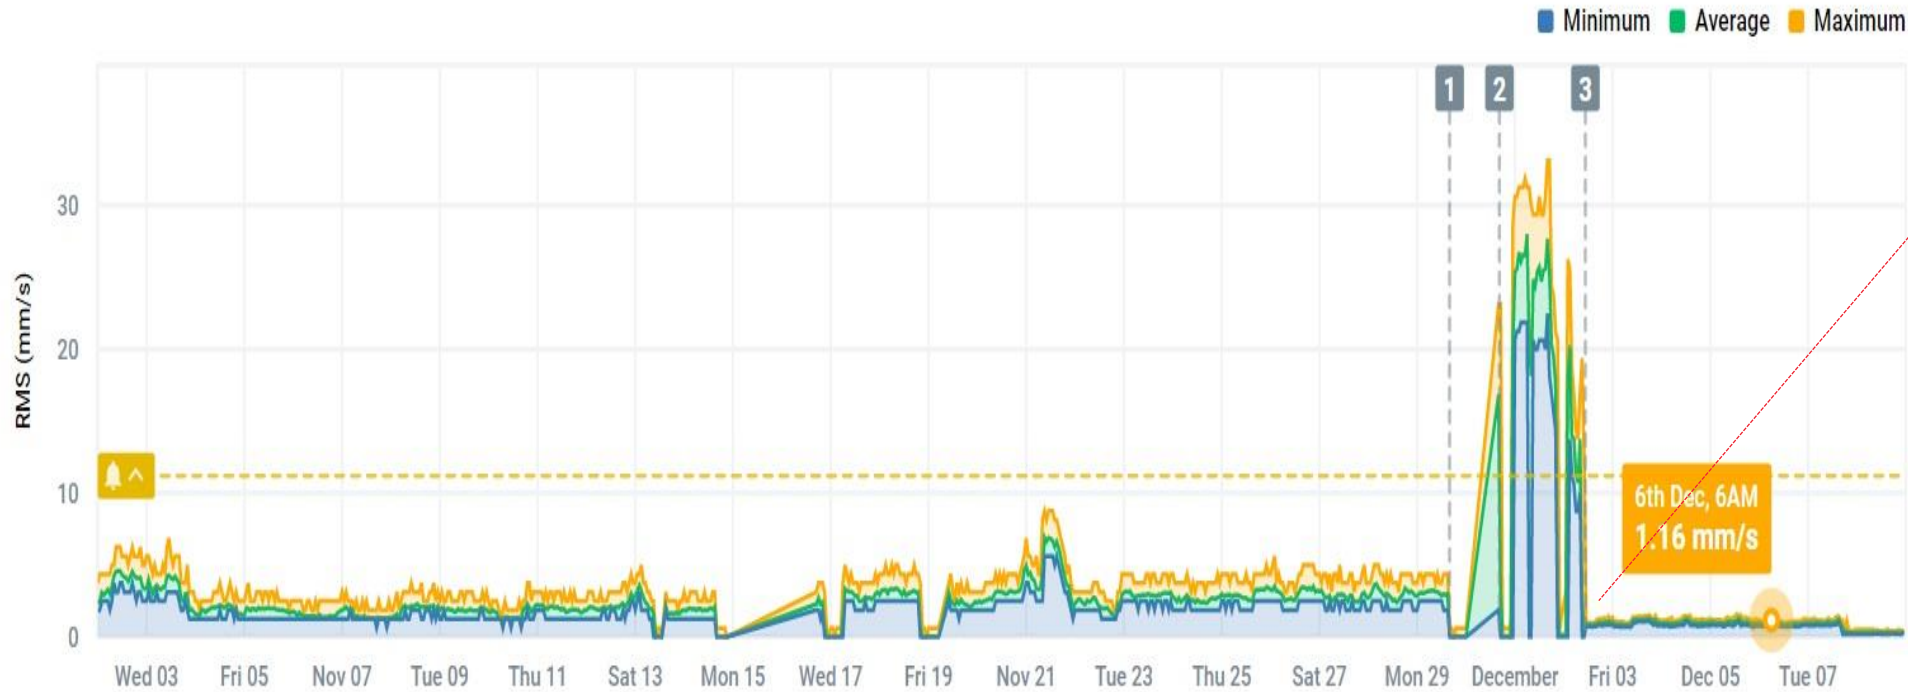

Analysis

- Levels reduced to 1mm/sec after fan clean.
- Investigation planned into why fan had build up of dirt as classed as "Clean Fan"



FURTHER INFORMATION

Customer Support

RMS Ltd. No.42 Goldcrest Close. Longridge Park.

Colchester. Essex CO4 3FN.

Company Reg No. 03808313. VAT No. GB 741737428.

Tel/Fax: +44 (0)1206 791917

Email: info@rms-reliability.com

rms-reliability.com